


10'



Top View

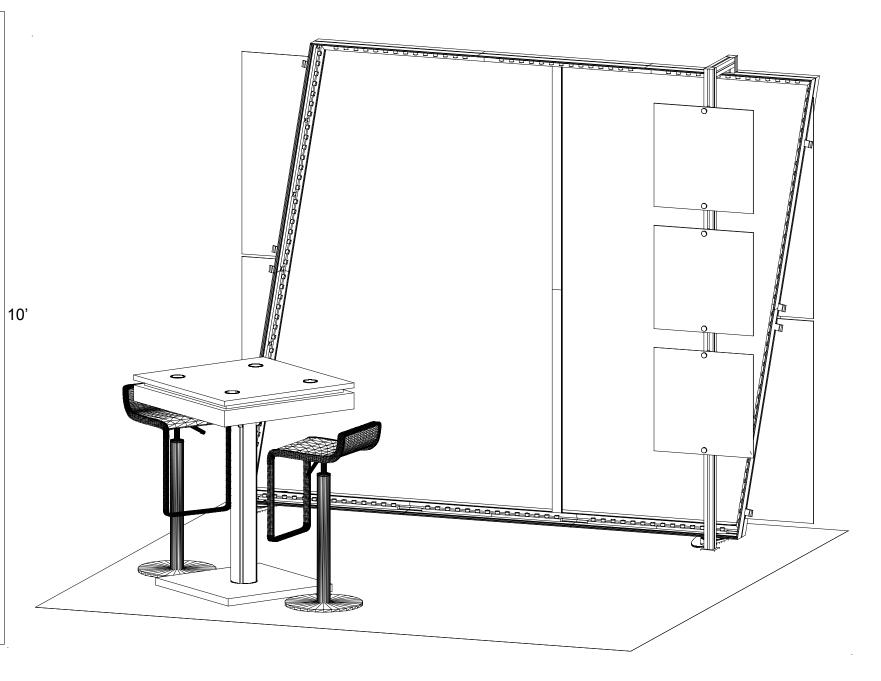

General Setup Instructions


- Read entire setup instruction manual prior to unpacking parts and pieces.
- The setup instructions are created specifically for this configuration.
- Setup instructions are laid out sequentially in steps, including exploded views with detailed explanation for assembly.

Cleaning & Packing


- For Cleaning Metal, Plex, & Laminate Parts: Use a MILD NON-ABRASIVE cleanser and soft cloth/paper towel to clean all surfaces.
- Keep exhibit components away from heat and prolonged sun exposure. Heat and UV exposure will warp and fade components.
- Retain all provided Packing Materials. All provided packing materials are for ease of repacking & component protection.

Disassembly

- For loss prevention, tighten all set screws and locks during disassembly.

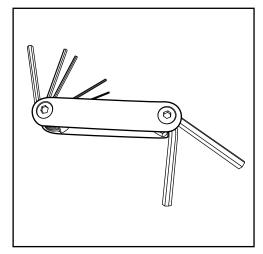


Hex Tool - Essential for Assembly

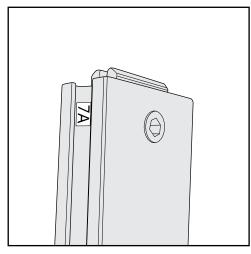


Part Identification - Numbering




MARNING

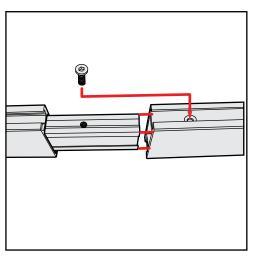

Spline Connection

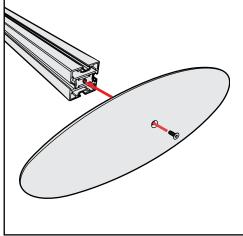

Base Plate & Extrusion Connection

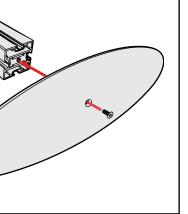






DO NOT USE POWER TOOLS




LADDERS OR LIFTS MAY BE REQUIRED



ALL CONNECTIONS MUST BE TIGHTLY SECURED

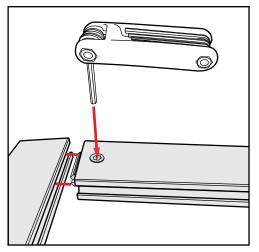


Extrusion & Lock Connection

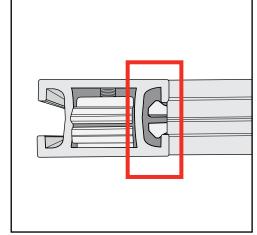



Engaged Lock




- 1) Locate channels along the edges of extrusions
- 2) Insert graphic corners first into channels then center point of graphic into channels. Allows for proportional fit around the perimeter of the extrusion.
- 3) Working from center to corner, slide silicon edge on graphic into channel.
- 4) After all edges of graphic have been inserted into channels, step back and assess graphic fit, make adjustments where needed.

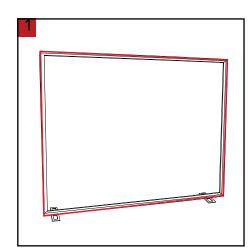

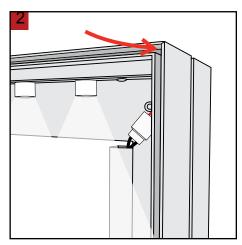

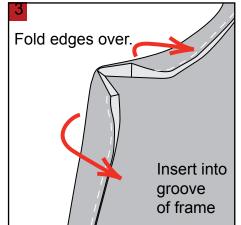

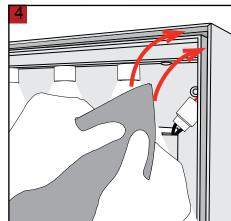




Corner Bracket Assembly

- Slide TWO-PIECE TS RV 2 L-bracket into Interior Center Slot of extrusion so that two set screws are inside groove. Tighten two set screws to secure.
- 2) Slide one A1 L-Bracket into outer interior grooves of upper and lower horizontals. Tighten set screws to secure.
- Slide vertical extrusion over exposed ends of brackets in lower horizontal.
 Tighten set screws to secure.
- 4) Slide exposed ends of installed brackets of upper horizontal into open ends of verticals. Tighten set screws to secure.

Disassembly


1) Loosen set screws on brackets and slide extrusions off of brackets.

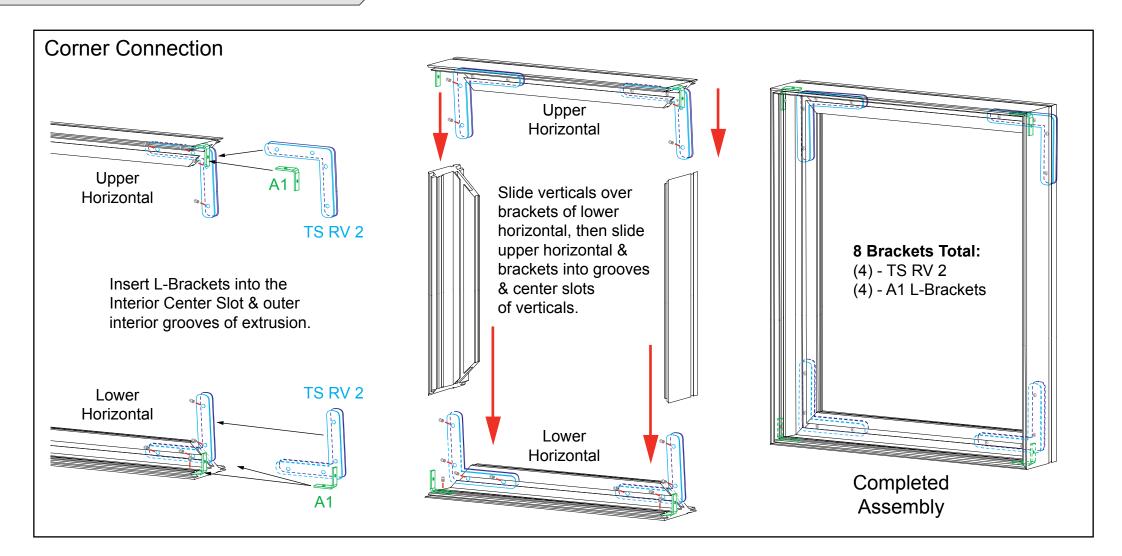

Straight Bracket Assembly

- 1) Slide TWO-PIECE TS RV 4 straight bracket into Interior Center Slot of extrusion, so that two of the set screws are inside groove. Tighten two set screws to secure.
- Slide one V4 Connector into outer interior groove of extrusion, so that one set screw is inside groove. Tighten set screw.
- 3) Slide connecting extrusion over exposed ends of bracket & connector. Tighten all remaining set screws to secure extrusions.




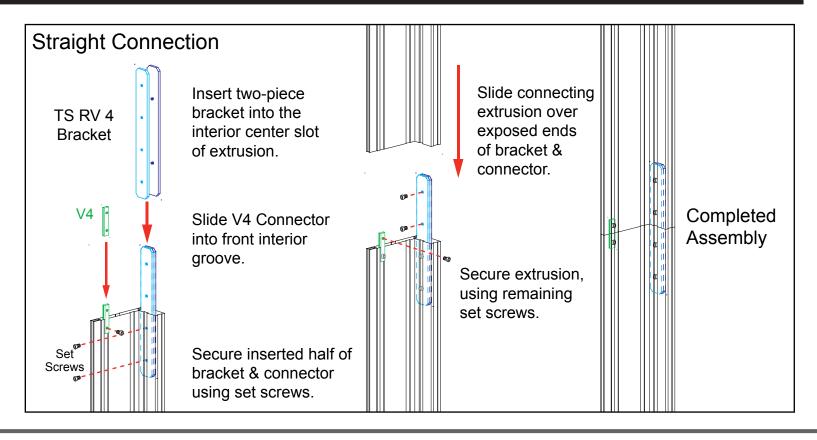




© 2020


Top View of Each Level

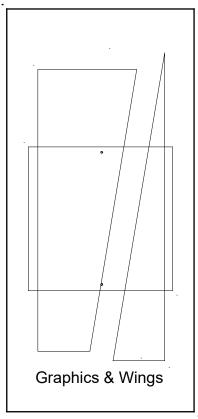


Level 1 (Bottom Level)

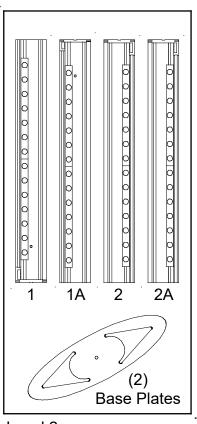

Level 2

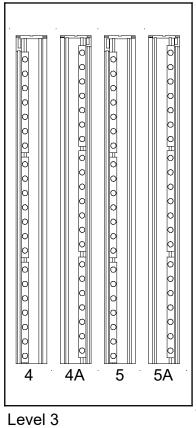

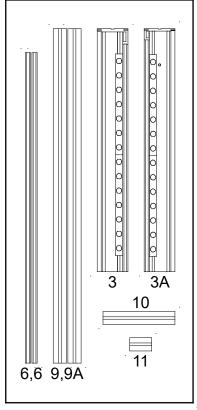

Level 4

Graphics

Setup Hardware

SEGUE DESIGNS	Order #XXXXX Crate Packing	


Order #XXXXX VK-1962 Frame Assembly


Item	Qty.	Description
1,1A	1,1	33.6754" CEI110 Horizontal Extrusion
2,2A	1,1	33.6753" CEI110 Horizontal Extrusion
3,3A	1,1	33.6753" CEI110 Horizontal Extrusion
4,4A	1,1	45.6185" CEI110 Vertical Extrusion
5,5A	1,1	45.6185" CEI110 Vertical Extrusion
6,6A	1,1	43.1767" Z45 Vertical Extrusion
7	2	Base Plate
8	1	Base Plate
9,9A	1,1	46.5" S44 Vertical Extrusion
10	1	10" S44 Horizontal Extrusion
11	1	3" S44 Vertical Extrusion

Assemble CEI110 frame flat on floor.


Steps:


- 1) Assemble [1,2,3] [1A,2A,3A] [4,5] and [4A,5A] together with straight brackets. See CEI110 Frame Assembly sheet Straight Bracket Assembly details.
- 2) Attach vertical assemblies [4/5] [4A/5A] and horizontal assemblies [1/2/3] [1A/2A/3A] together with Corner brackets. See CEI110 Frame Assembly sheet Corner Bracket Assembly details.
- 3) Connect verticals [6] together then attach between [2] and [2A]. See PR53 Connector detail.
- 4) Attach verticals [9] and [9A] together. See PR53 Connector detail.
- 5) Attach base plates [7] to horizontals [1] and [2], using bolts.
- 6) Attach base plate [8] to vertical assembly [9/9A], using a bolt.
- 7) Assemble [8/9/9A] [10] and [11] then attach to top of horizontal [1A]. Tighten locks to secure.
- 8) Connect lighting cords and attach transformers. See Light to Light Connection and Light to Transformer Connection details.

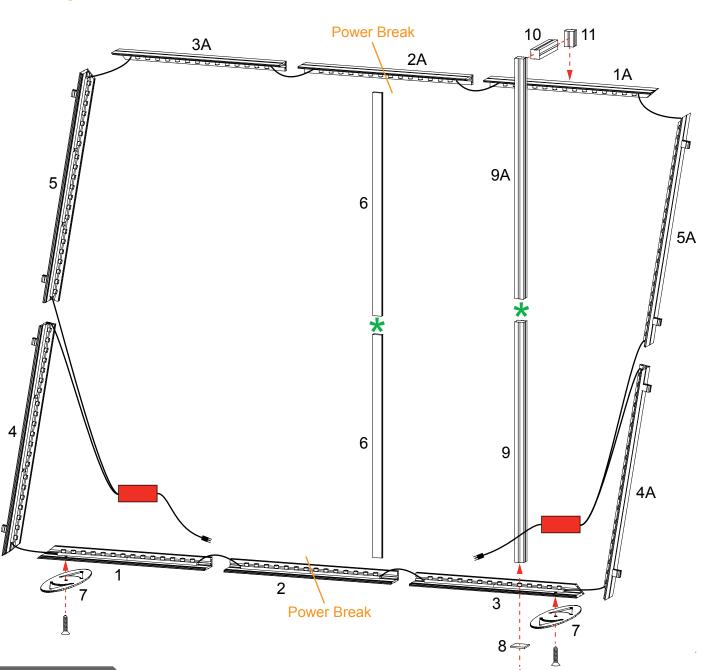

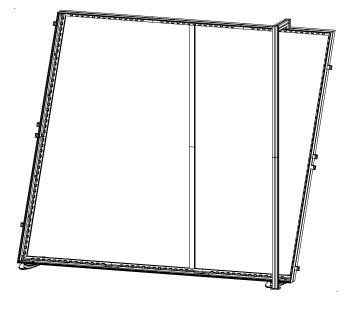

Completed Assembly

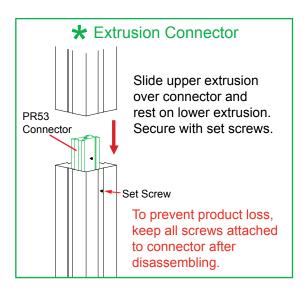

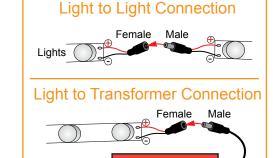


Maximum of 14 lights per transformer.

144W / 6A / 24V





Steps:


- 1) Attach wings to A10 clamps. See A10 Clamp detail.
- 2) Attach graphics to vertical extrusion, using standoffs and screw caps.
- 3) Install SEG graphic to front of assembled frame and SEG blocker fabric to back. See SEG Graphic Installation sheet for instruction.

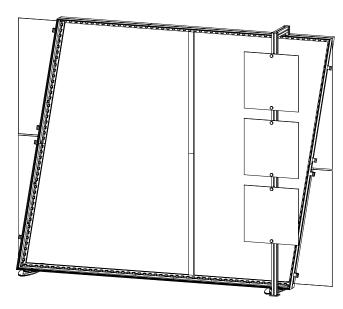

Completed Assembly

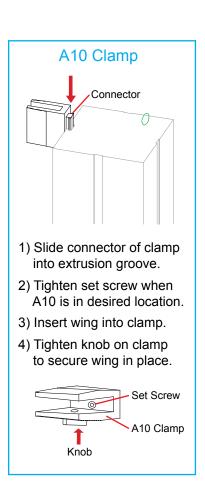


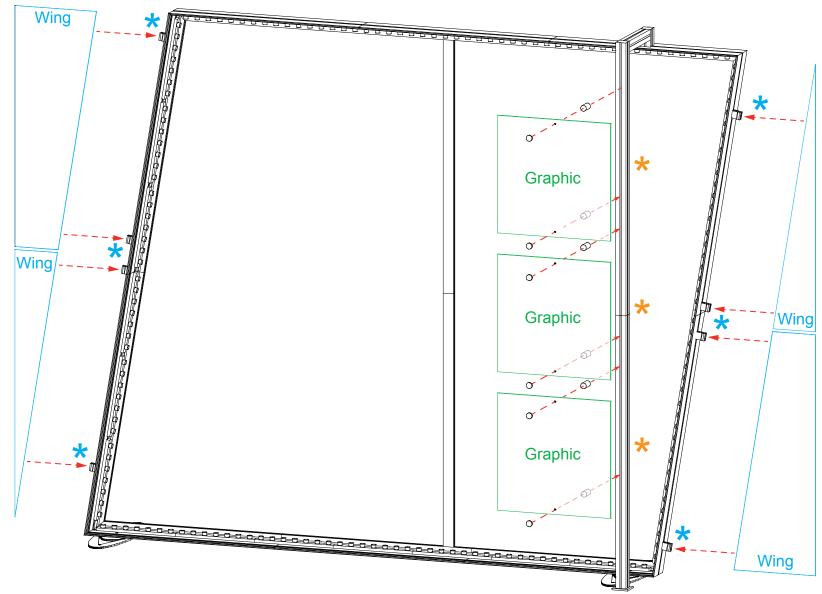


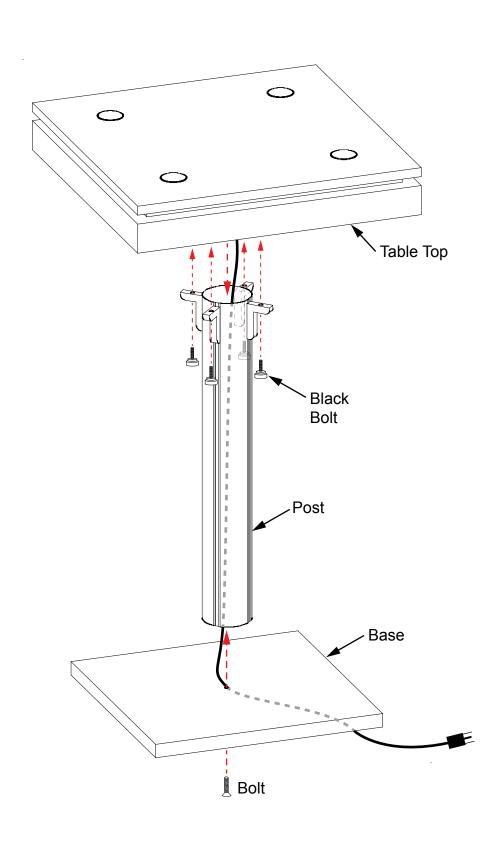

Steps:

- Connect base to post, using bolt.
 Route cord from table top through post and base.
 Connect table top to post, with fixed brackets, using black bolts.

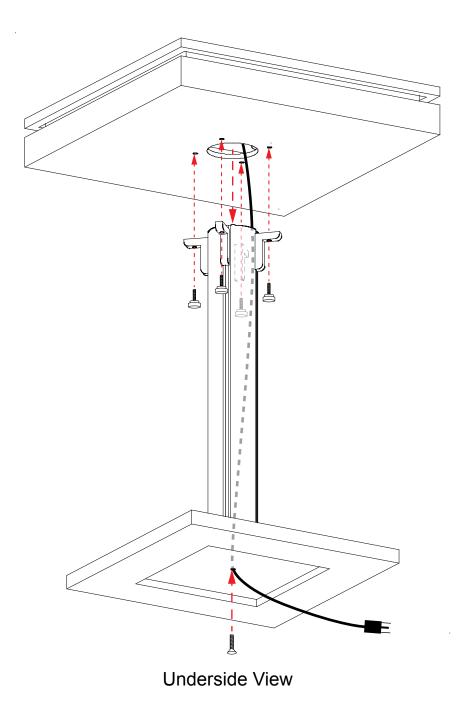

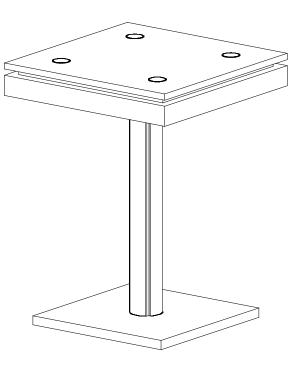

Completed Assembly